
SKILLING, HELLE, CHRISTIANSEN, ROBERTSON — Structural & Civil Engineers

PROJECT: THE WORLD TRADE CENTER | TITLE: EXTERIOR WALL - TRUSS SEAT REPAIR | DATE: 9/2/69


REVISIONS

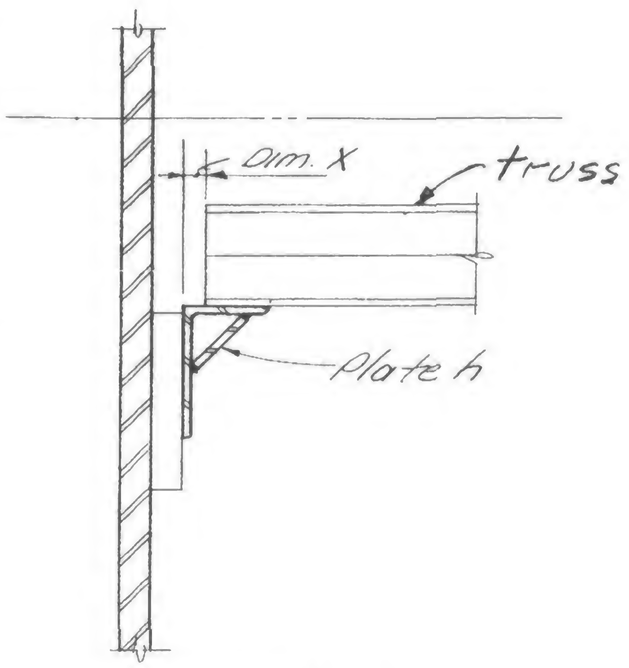

Detail A


SCHEDULE OF REPAIR DETAIL						
DIM. X	FLOORS					
	10-40	44	45-48	49-74	78	79-106
To 1/16"	None	None	None	None	None	None
1/8" to 1/2"	A	A	A	A	B	A
9/16" to 1"	A	B	A	A	B	A
1 1/16" to 1 1/2"	A	B	A	B	B	B

Note: Where repair is required, it is likely that damper connection will not mate. See 19-AB-960 for repair.

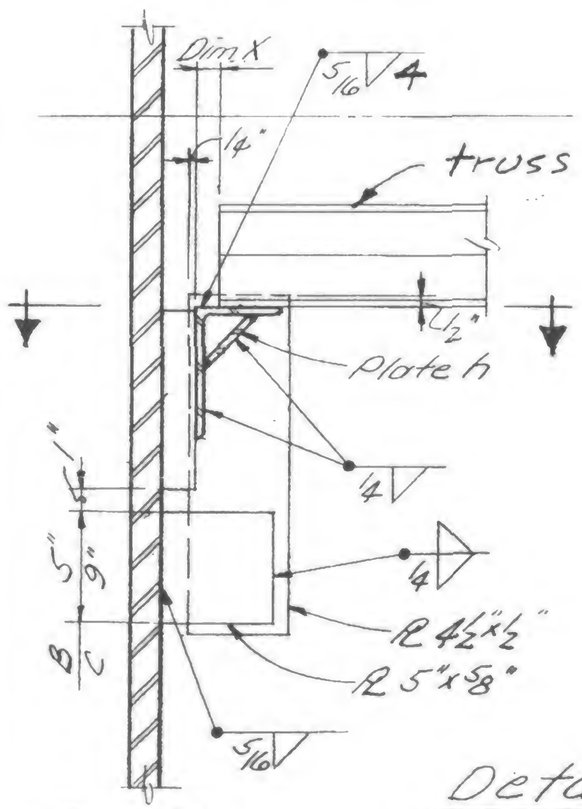


Section

Detail B

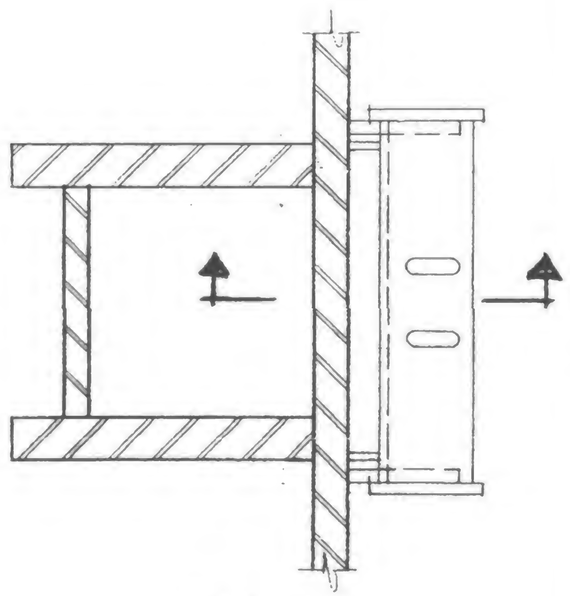

Plan

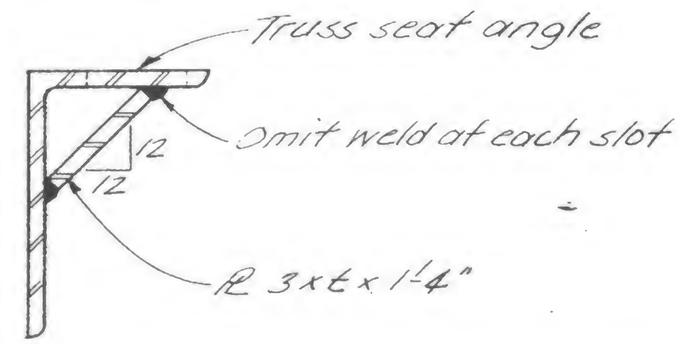

Floors 10-40, 45-74, 79-106
t = 5/16" typical, except
t = 3/8" @ Cols. 111, 149, 217, 243, 311, 349, 417 & 443

Floors 44 & 78:
t = 1/2" typical, except
t = 5/8" @ Cols. 111, 149, 311 & 349

Detail of Plate h

DESIGNED H. Root
DRAWN J. Adams
REVIEWED W. Brewer

19-AB-959