
SKILLING, HELLE, CHRISTIANSEN, ROBERTSON — Structural & Civil Engineers


PROJECT: THE WORLD TRADE CENTER | TITLE: K1-EL. 310 REPAIR DETAIL FOR EXISTING STEEL | DATE: 6-12-72

REVISIONS

6-16-72

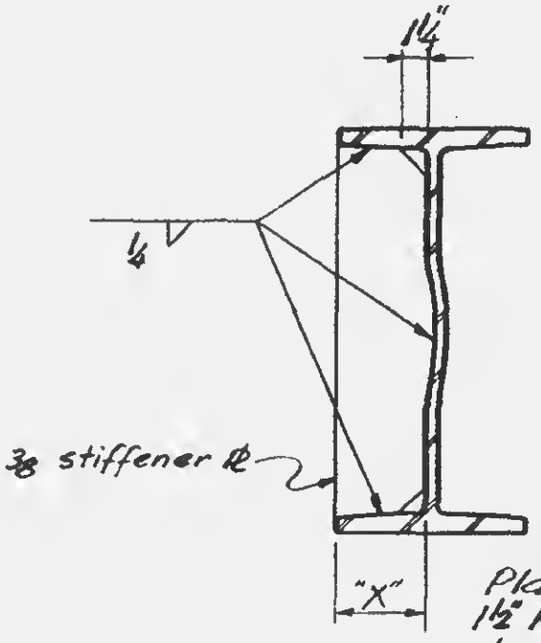

Section a-a

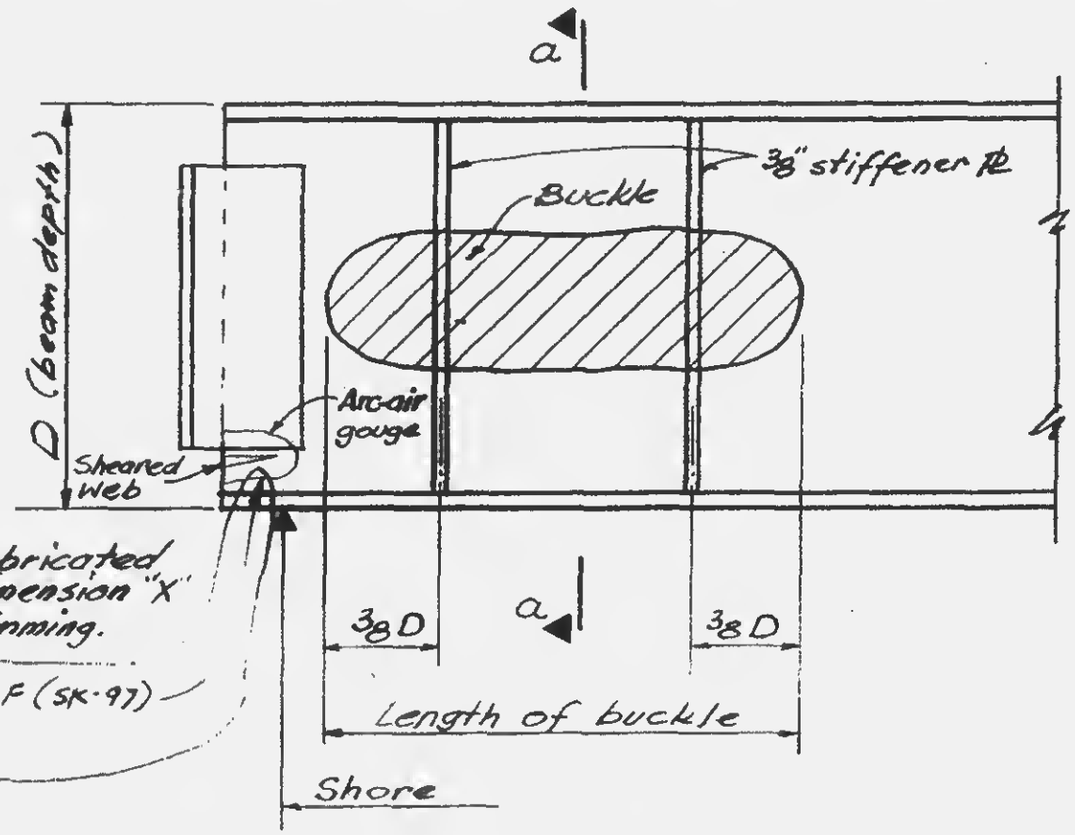

⅜" stiffener plates to be placed as follows:

LENGTH OF BUCKLE	NO. OF PLATES	PLACEMENT OF STIFFENERS
0.75 D	1	Center in bulge
0.75 D > 1.00 D	2	as shown above
1.00 D > 2.00 D	3	2 outside as shown above center one centered between

Procedure

1. Shore beam.
2. Remove connection.
3. Drill hole to terminate crack
4. Straighten and arc-air gouge area of sheared web.
5. Replace with sound weld metal or remove distorted material and replace with full penetration welded A36 patch plate of same thickness of web.
6. Replace with same type connection, but capacity to be as shown in Plan.
7. Trim vertical stiffener plates to fit and install number and location as shown in table
8. Remove shores.

Detail F6

Buckled web & sheared web

LICENSED PROFESSIONAL ENGINEER — LESLIE E. ROBERTSON — No. 34360 — UNIVERSITY OF THE STATE OF NEW YORK

DESIGNED

DRAWN

REVIEWED

12-JK7-10